


K3D60a $\pm 10\text{N}$, $\pm 20\text{N}$, $\pm 50\text{N}$, $\pm 100\text{N}$, $\pm 200\text{N}$, $\pm 500\text{N}$

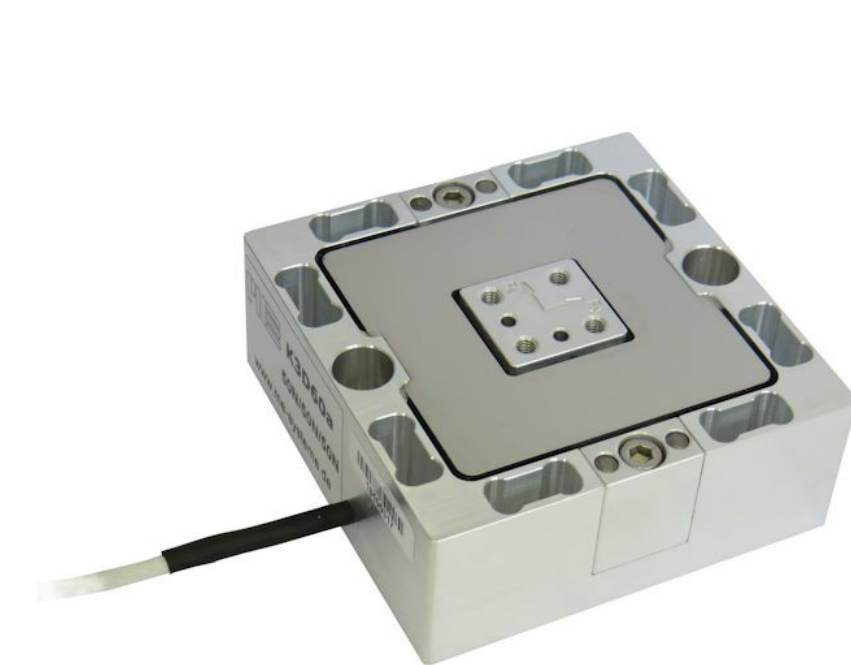

Description


The K3D60a three-axis sensor is suitable for measuring force on three mutually perpendicular axes.

The new 3-axis sensor K3D60a is a further development of the series K3D60 and it is available in the measuring ranges $\pm 20\text{N}$ to $\pm 500\text{N}$.

Up to a rated load of $\pm 100\text{N}$, these sensors are made of aluminum, from a rated load of $\pm 200\text{N}$ these force sensors are made of stainless steel.

The sensor K3D60 (11/2009 ... 02/2016) 2016 was replaced by the improved implementation K3D60a.

Dimensions

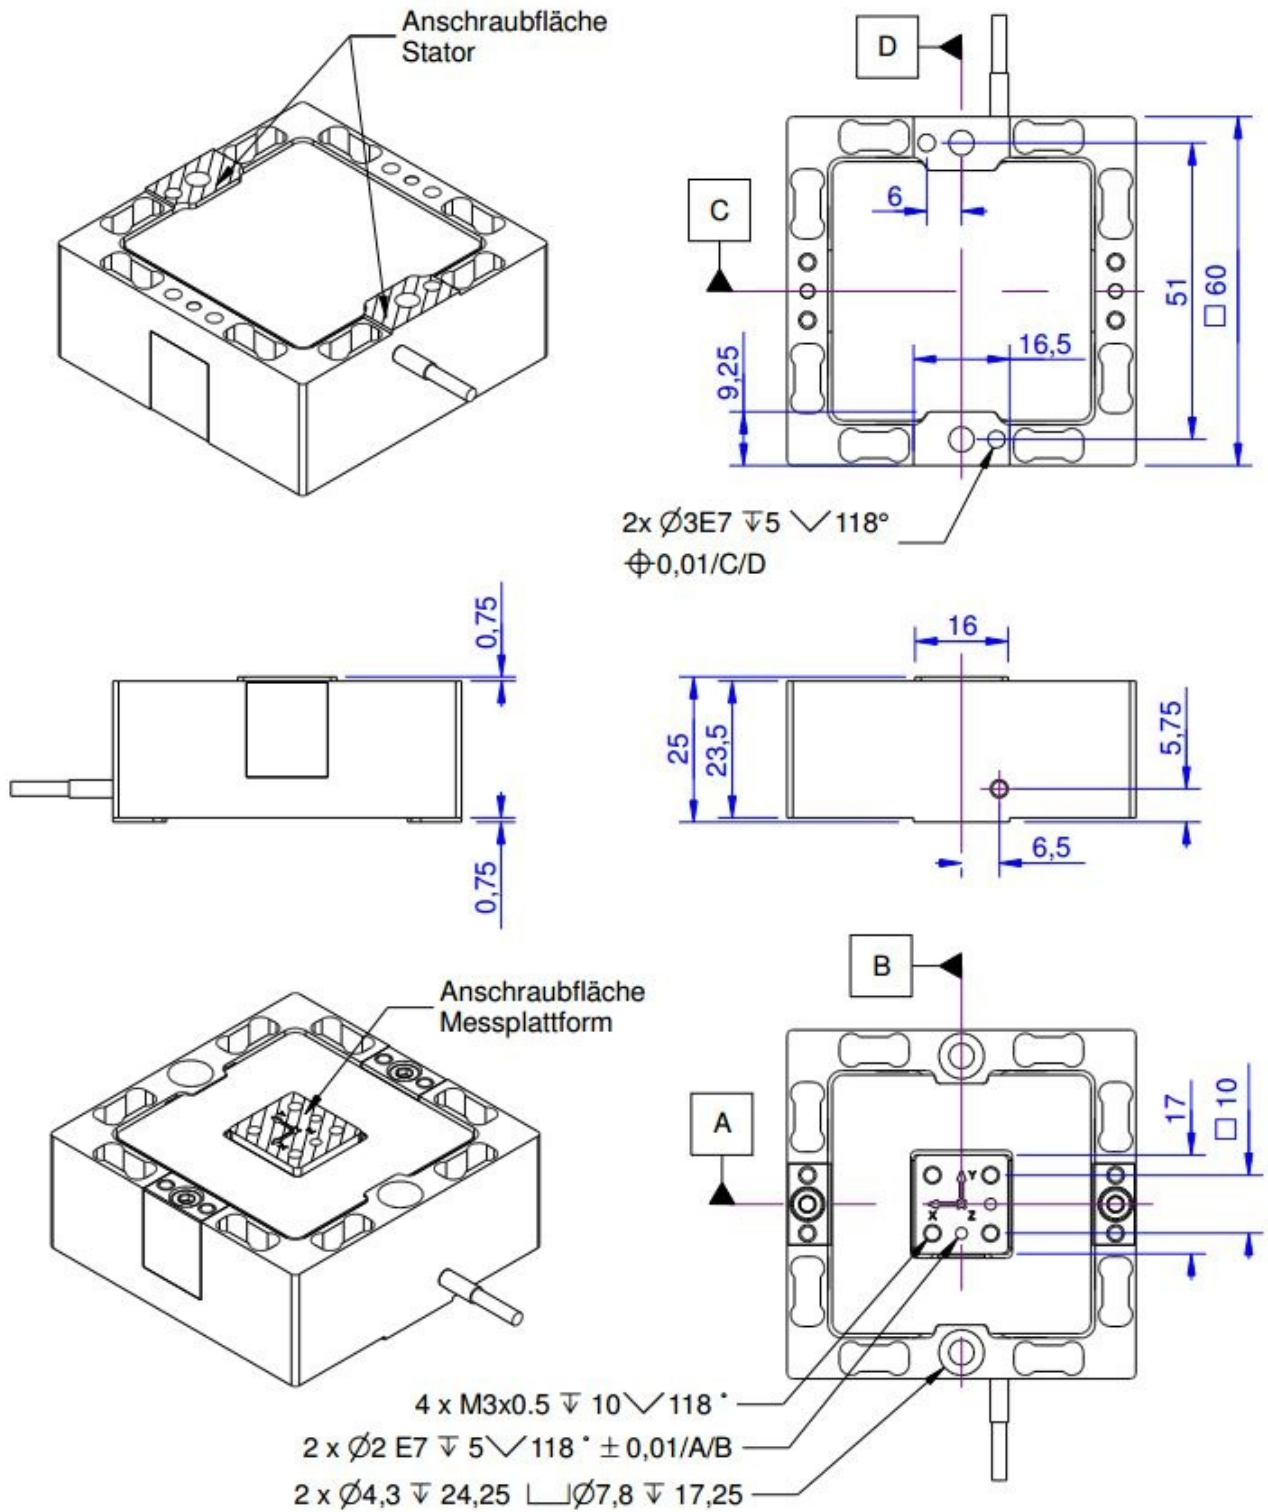

Technical Data

Kraftsensoren

Type	3-axis force sensor
Force direction	Tension / Compression
Force introduction	Inner thread
Dimension 1	4x M3x0,5
Sensor Fastening	T through bore
Dimension 2	2x Ø4,3
Operating force	200 %FS
Rated displacement	0.1 mm
Dimensions	60 x 60 x 25 mm x mm x mm
Height	25 mm
Length or Diameter	60 mm
Torque limit	20 Nm
Bending moment limit	20 Nm

Elektrische Daten

Rated output x-axis	0.5 mV/V / FS
Rated output y-axis	0.5 mV/V / FS
Rated output z-axis	0.5 mV/V / FS
Zero signal	0.1 mV/V
Rated range of excitation voltage f	2.5 ... 5 V
Operating range of excitation voltage f	1 ... 10 V
Input resistance x-axis	395 Ohm
Output resistance x-axis	350 Ohm
Input resistance y-axis	395 Ohm
Output resistance y-axis	350 Ohm
Input resistance z-axis	395 Ohm
Output resistance z-axis	350 Ohm
Insulation resistance	5 GOhm
Tolerance input resistance	10 Ohm
Tolerance output resistance	10 Ohm

Precision

Accuracy class	1%
Relative linearity error	0.2 % FS

Relative zero signal hysteresis	0.02	% FS
Temperature effect on zero signal	0.02	%FS / K
Temperature effect on characteristic value	0.02	%RD/ K
Relative creep	0.1	% FS

Connection Data

Connection type	12 conductor open
Name of the connection	STC-32T-12
Cable length	3 m

Temperature

Rated temperature range f	-10 ... 70	°C
Operating temperature range f	-10 ... 85	°C
Storage temperature range f	-10 ... 85	°C
Environmental protection	IP65	

Exzentrizität und Übersprechen

Influence of eccentric load to FS	1	%FS / 10Nm
Crosstalk from x to y at rated load	2	%FS
Crosstalk from y to x at rated load	2	%FS
Crosstalk from z to x/y at rated load	2	%FS
Crosstalk from x/y to z at rated load	2	

Abbreviation : RD: „Reading“; FS: „Full Scale“;

1) The exact rated output is reported in the test report .

2) K3D60a with 370 and 390 Ohm input impedance and 350 ohm output resistance

Pin Configuration

Channel	Symbol	Description	Wire colour
1	+Us	positive bridge supply	brown
	-Us	negative bridge supply	white
	+Ud	positive bridge output	green
	-Ud	negative bridge output	yellow
2	+Us	positive bridge supply	pink
	-Us	negative bridge supply	grey
	+Ud	positive bridge output	blue
	-Ud	negative bridge output	red
3	+Us	positive bridge supply	purple
	-Us	negative bridge supply	black
	+Ud	positive bridge output	orange
	-Ud	negative bridge output	transparent

Pressure load: positive output signal.

Shield- transparent.

accessories

Description Description		
	GSV-1A4 SubD37/2	4-channel strain gauge measuring amplifier for sensors with strain gauges. Adaptation of the sensor via <u>Sub-D-37 connector</u> . Output $\pm 10V$ and 4 ... 20mA via 15-pin SUB-D (female); Input sensitivity 2mV/V;
	GSV-4USB SubD37	4-channel strain measurement amplifier with USB port with configurable input for strain gauges, temperature sensors, active sensors, displacement sensors and other sensors. Sensor connection via 1 piece Sub D37 connector



GSV-1A4
SubD37/2

4-channel strain gauge measuring amplifier for sensors with strain gauges. Adaptation of the sensor via Sub-D-37 connector. Output $\pm 10V$ and 4 ... 20mA via 15-pin SUB-D (female); Input sensitivity 2mV/V;



GSV-4USB
SubD37

4-channel strain measurement amplifier with USB port with configurable input for strain gauges, temperature sensors, active sensors, displacement sensors and other sensors. Sensor connection via 1 piece Sub D37 connector