4SC

MEMS Capacitive Accelerometer

ASC 4211LN

Uniaxial

MEMS Capacitive

Measurement Range: ±2 to ±400 g Noise Density: 7 to 400 μg/√Hz

Frequency Range (±5 %): DC to 1000 Hz

Aluminum Housing

Made in Germany



MEMS Capacitive Accelerometer

The key components in capacitive accelerometers are high-quality micro-electromechanical systems (MEMS) that feature excellent long-term stability and reliability. This technology enables the measurement of static (DC) and constant accelerations, which can be used to calculate the velocity and displacement of moving objects. Depending on the design of the spring-mass-damping system, however, it is also possible to detect dynamic (AC) accelerations with amplitudes up to ± 400 g and within a frequency response range of up to 1 kHz (± 5 %) or 4.2 kHz (± 3 dB). Other advantages of capacitive accelerometers are their outstanding temperature stability, excellent response behavior and achievable resolution.

Description

The accelerometers of type ASC 4211LN are based on proven MEMS technology and capacitive operating principle. The integrated electronic circuitry enables a differential analog voltage output (± 4 V FSO) and flexible power supply voltage from 6 to 40 VDC. The LN (Low Noise) accelerometers from ASC provide an outstanding noise performance from 7 to 400 μ g/ \forall Hz which is essential for demanding measurements of smallest frequencies and amplitudes.

The sensors feature a lightweight, reliable aluminum housing with protection class IP67 and an integrated cable with configurable length and connectors.

The uniaxial ASC 4211LN have an ultra-compact design and weigh only 3 grams. This makes them ideal for measuring applications in hard-to-access installations, such as testing the operational stability of automotive components.

Features

- Very Low Noise Differential Voltage Output
- DC Response, Gas damped
- High Shock Resistance
- Excellent Offset and Scale Factor Stability


Options

- Customized Cable Length
- Customized Connector
- TEDS Module

Applications

- Operational Stability Tests
- Structural Analyses
- Flutter Tests

More applications in several markets are figured out on our web page www.asc-sensors.de

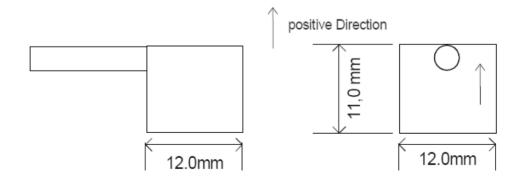

MEMS Capacitive Accelerometer



Typical Specification

1 74	/In	~	m	10

Measurement Range	g	±2	±5	±10	±25	±50	±100	±200	±400
Scale Factor (sensitivity)	mV/g	2000	800	400	160	80	40	20	10
Noise Density	μg/√Hz	7	12	18	25	50	100	200	400
Min. Frequency Response Range (±5 %)	Hz	0 to 100	0 to 100	0 to 300	0 to 500	0 to 650	0 to 650	0 to 1000	0 to 1000
Max. Frequency Response Range (±3 dB)	Hz	0 to 525	0 to 800	0 to 1100	0 to 1750	0 to 2100	0 to 3000	0 to 3600	0 to 4200
Amplitude Non-Linearity	% FSO	<0.15 (typ) <0.5 (max)							
Transverse Sensitivity	%	<2 (typ) <3 (max)							

Electrical

Power Supply Voltage	V	6 to 40							
Operating Current Consumption	mA								
Offset (bias)	mV	±80	±80	±40	±40	±40	±40	±40	±40
Broadband Noise (over min frequency range ±5 %)	μV	140	95	125	90	100	100	125	125
Output Impedance	Ω	90							
Isolation		Integrated electronic circuitry is isolated from the sensor housing Sensor housing and cable shielding are internally connected							

Environmental

Temperature Coefficient of the Scale Factor (max)	ppm/K				±2	00			
Temperature Coefficient of the Offset (max)	mg/K	±0.8	±2	±4	±10	±20	±40	±80	±160
Operating Temperature Range	°C	-20 to +125							
Storage Temperature Range	°C	-20 to +125							
Shock Limit (max peak)	g	2000	2000	5000	5000	5000	5000	5000	5000
Protection Class		IP67							

Physical

Sensing Element		MEMS Capacitive
Case Material		Anodized Aluminum
Connector at Cable End		Optional
Mounting		Adhesive
Weight (without cable)	gram	3
Cable		13 gram per meter AWG 30 Polyurethane (PUR) Diameter 3.1 mm

MEMS Capacitive Accelerometer



Sensor Calibration

Factory Calibration (supplied with the sensor)

Part Number		#12054	#12054	#14514	#14523	#14527	#14527	#14531	#14531
Measurement Range (sensor)	g	±2	±5	±10	±25	±50	±100	±200	±400
Applied Frequency (min)	Hz	1	1	10	10	10	10	10	10
Applied Frequency (max)	Hz	100	100	300	500	650	650	1000	1000
Input Amplitude	m/s²	5	5	50	100	200	200	200	200
Reference Frequency for Determination of Scale Factor	Hz	16	16	80	80	80	80	80	80

Calibration according DIN ISO 17025 (order separately)

Part Number		#14512	#14512	#14516	#14525	#14529	#14529	#14533	#14533
Measurement Range (sensor)	g	±2	±5	±10	±25	±50	±100	±200	±400
Applied Frequency (min)	Hz	0.5	0.5	10	10	10	10	10	10
Applied Frequency (max)	Hz	150	150	500	800	1600	1600	2000	2000
Input Amplitude	m/s²	5	5	50	100	200	200	200	200
Reference Frequency for Determination of Scale Factor	Hz	16	16	80	80	80	80	80	80

Remarks:

- The conversion factor 1 g corresponds to 9.80665 m/s².
- If any other calibration procedure is required, don't hesitate to contact us. Our services include both factory calibration and calibration in accordance with DAkkS guidelines.
- Furthermore, sensors have to be calibrated regularly to ensure accurate and precise results. On request we will be glad to remind you of the next scheduled calibration of your sensors.

Cable Code / Pin Configuration (4 Wire System)

	Pin Color Code		Description				
1	Supply +	Red	Power supply voltage +6 to +40 VDC				
2	Supply -	Black	Power GND				
3	Signal +	Green	Positive, analog output voltage signal for differential mode				
4	Signal - White Negative, analog output voltage signal for differential mode						
	Cable shielding is provided as a tinned-copper braiding which is also internally connected to the sensor housing						





Ordering Information

Series	Model	- Range [g] -	Cable Length [m]	Connector & Pinout
ASC 42	11LN	002	6	А
		005		
		010		
		025		
		050		
		100		
		200		
		400		

Example:

ASC 4211LN-002-6A

Ordering information are based on standard configurations. All customized versions regarding connector and/or pinout will lead to a corresponding product match code:

- Standard length of the integrated cable is 6 meters. However, different customized cable lengths are possible on request.
- Standard version has no connector at the cable end which is identified by "A" in the product match code. However, it is possible to assemble almost all connector types during production.

MEMS Capacitive Accelerometer



Safety Precaution for Installing and Operating

This data sheet is a part of the product. Read the data sheet carefully before using the product and keep it available for future operation. Handling, electrical connections, mounting or any other work performed at the sensor must be carried out by authorized experts only. Appropriate safety precautions must be taken to exclude any risk of personal injury and damage to operating equipment as a result of a sensor malfunction.

Handling

The sensor is packaged in a reliable housing to protect the sensing elements and integrated electronic components from the ambient environment. However, poor handling of the product can lead to damages that may not be visible and cause electrical failure or reliability issues. Handle the component with caution:

- Avoid shocks and impacts on the housing, such as dropping the sensor on hard surface
- Never move the sensor by pulling the cable
- Make sure that the sensor is used within the specified environmental conditions
- Transport and store the sensor in its original or similar packaging
- The sensor should be mounted on a stable flat surface with all screws tightened or other mounting options
- When adhesives are used to mount the sensors, please select the corresponding products according to permanent or removable mounting, ambient temperature range as well as quality of the mounting surface
- Avoid any deformation during mounting the sensor
- Mounting tolerances may have an influence on the measured result

Electrical

ASC's inertial sensors are working with many established data acquisition systems. However, make sure that a proper DAQ is used, for the corresponding operation principle of the sensor. Furthermore, suitable precautions shall be employed during all phases of shipment, handling and operating:

- Active sensor pins are susceptible to damage due to electrostatic discharge (ESD)
- Make sure that the sensor is used within the specified electrical conditions
- Check all electrical connections prior to initial setup of the sensor
- An incorrect wiring of the signal or power supply connections will lead to damages of the sensor
- Completely shield the sensor and connecting cable according to your application
- Do not perform any electrical modifications at the sensor
- Do not perform any adaptions on the wiring or connectors while the device under power
- Never plug or unplug the electrical connection while the sensor is under power
- When a certain pin is not used during operation, make sure that the pin is insulated

Quality

- We have a quality management system according to ISO 9001:2015.
- The Deutsche Akkreditierungsstelle GmbH (DAkkS) has awarded to our calibration laboratory the **DIN EN ISO/IEC 17025:2018** accreditation for calibrations and has confirmed our competence to perform calibrations in the field of mechanical acceleration measurements. The registration number of the certificate is **D-K-18110-01-00**.
- The sensors described in the data sheet are CE-compliant.





ASC GmbH | Ledererstraße 10 | 85276 Pfaffenhofen | Germany | Phone: +49 8441 786547-0 | E-mail: office@asc-sensors.de | www.asc-sensors.de

Specifications are subject to change without notice. All data, information, statements, photographs and graphic illustrations made in this data sheet are without any obligation and raise no liabilities to or form part of any sales contracts of ASC GmbH or any affiliates for components referred to herein. © ASC GmbH 2021. All rights reserved. No part of this copyrighted work may be reproduced, modified or distributed in any form or by any means, or stored in any database or retrieval system, without the prior written permission of ASC GmbH or its affiliates. Any such unauthorized use for any purpose is a violation of the relevant copyright laws.

Revision: 21st December 2023 5/5